

PINOD





Návod k montáži a seřízení

Návod k seřízení

$$q_v = k \cdot \sqrt{\Delta p_m}$$

		k		
PINODq		100	125	160
		5*4=20	6*4=24	8*6=48
Uzavřené řady	A	2,5	3,1	6,2
	1	2,0	2,6	5,4
	2	1,5	2,1	4,7
	3	1,0	1,5	3,9
	4	0,5	1,0	3,1
	5		0,5	2,3

		k		
PINODr		100	125	160
		6*4=24	6*5=30	8*7=56
Uzavřené řady	A	2,5	3,0	5,7
	1	2,1	2,5	5,0
	2	1,7	2,0	4,3
	3	1,2	1,5	3,5
	4	0,8	1,0	2,8
	5		0,5	2,1

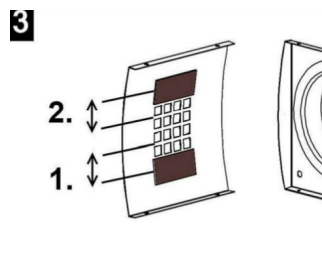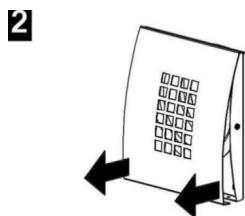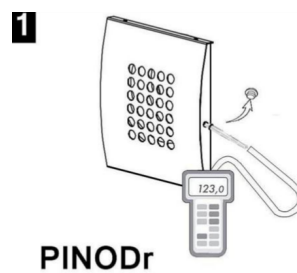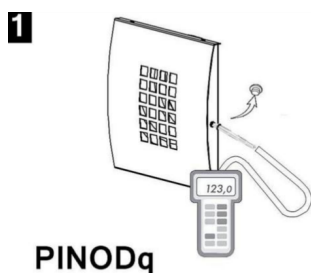

Návod k údržbě

